

## 2005 Chevrolet Cobalt L4-2.2L VIN F

Vehicle » Technical Service Bulletins » All Technical Service Bulletins » Ignition - Key Stuck in Ignition Lock Cylinder

Bulletin No.: 06-02-35-004

Date: February 02, 2006

TECHNICAL

Subject:

Ignition Key Stuck (Replace Shifter Assembly or Ignition Lock Cylinder Assembly)

Models:


2005-2006 Chevrolet Cobalt

2005-2006 Pontiac Pursuit (Canada Only)

Condition

Some customers may comment that they cannot remove the key from the ignition.

Cause 1

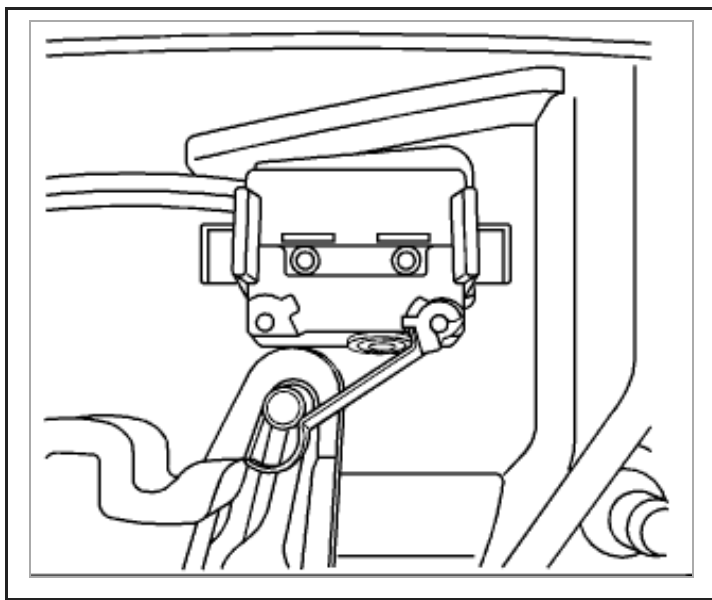

The pin that activates the micro-switch may have moved out of position (refer to illustration above). This causes the micro-switch to fail to engage when the vehicle is placed in Park.

Cause 2

Metal flashing left in the cylinder may cause this condition.

Correction 1

Replace the shifter assembly.

## Correction 2

Replace the ignition lock cylinder.


Part Number	Description
15244165	Control Asm, A/Trans
15285311	Cylinder Kit

Parts Information

Warranty Information

Labor Operation	Description	Labor Time
K5225	Control Assembly, Floor Shift – Replace	Use Published Labor Operation Time
E7200	Cylinder, Ignition Lock – R&R or Replace	

For vehicles repaired under warranty, use the table.

<p>GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.</p>		<p>WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION</p>
--	---	--

Disclaimer